

Textron (Beech) A36

**Airworthiness Directives
Compliance Report**

Date: 1/30/2024

Airframe: Textron (Beech) A36

Misc:

Tail #: N42609
S/N: E-959
**CUSTOMER
COPY**

Hours:

Airframe: Textron (Beech) A36

AD#	Category	Subject	Amdt#	Eff Date	Recurring
84-09-01	Airframe	Window Emergency Egress	39-4847	05/25/84	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
88-21-02	Airframe	Seat Tracks	39-6028	10/31/88	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
91-17-01	Airframe	Elevator Trim Tab Actuators	39-7099	11/25/91	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
93-24-03	Airframe	Rudder Forward Spar	39-8752	01/21/94	Yes* (Terminating Action)
Date/Hours at Compliance:		Method of Compliance: STC installed		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
95-04-03	Airframe	Wing Carry Through Frame Inspection	39-9155	04/07/95	Yes
Date/Hours at Compliance: Hobbs 656Hrs		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours: hobbs 1156hrs		Signature:		Cert#: 3741762	
97-14-15	Airframe	Cabin and Utility Door Handle	39-10073	09/02/97	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with.		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
2003-01-01	Airframe	Right Hand Fuselage Panel	39-13012	02/27/03	
Date/Hours at Compliance: 1/30/2024 AFTT 6898.2		Method of Compliance: Visual inspection		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
2007-08-08	Airframe	Landing Gear Uplock Rollers	39-15025	05/25/07	Yes
Date/Hours at Compliance: 5/10/2026 Hrs 7010		Method of Compliance: Visual inspection and OPS check		Name: Matthew LaPrade	
Next Due Date/Hours: 5/10/2027 hrs 7110		Signature: 		Cert#: 3741762	
2008-13-17	Airframe	Circuit Breaker Toggle Switch	39-15580	08/06/08	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	
2009-25-01	Airframe	Pilot & Copilot Shoulder Harnesses	39-16118	01/08/10	
Date/Hours at Compliance:		Method of Compliance: Previously compiled with		Name: Matthew LaPrade	
Next Due Date/Hours:		Signature:		Cert#: 3741762	



CUSTOMER COPY

Invoice

6157

Date: May 15, 2026

Terms: Zelle

Waypoint Aviation Services

6873 Flight Rd.
Riverside, CA 92504
Krystal LaPrade • fly@waypointmro.com/ parts@waypointmro.com • 951-977-8361

Memo: Annual Inspection 4/20/2026
PRINTED

AIRCRAFT

N4260S

Beechcraft A36 Bonanza S/N: E959
hobbs: 1499.4

BILL TO

Phil Mueller
5030 Via Andrea
Thousand, CA 91320
(415)407-4805
fillmueller@outlook.com

PAID

Item	Discrepancy	Parts	Labor	Misc
1.	Annual Inspection Corrective Action	\$104.00	\$3,500.00	\$0.00
1-1	Conducted Annual inspection IAW Beechcraft Bonanza Maintenance manual. Serviced airframe, landing gear, cleaned, inspected and repacked wheel bearings. Cleaned and inspected fuel strainers, lubed control cables and flap tracks. Complied with FAR 91.207 paragraph (C) & (D) on ELT, Batteries expire 4/2027 I certify this Airframe has been inspected in accordance with an Annual Inspection and was found to be in an Airworthy Condition.			
1-2	Conducted Annual inspection IAW Continental IO-520 engines Maintenance manual. Serviced engine, cleaned and inspected fuel strainers. Cleaned, inspected, tested and gapped spark plugs. Replaced spark plug washers P/N M674. Removed cleaned and inspected fuel injectors. I certify this Engine has been inspected in accordance with an Annual Inspection and was found to be in an Airworthy Condition.			
1-3	Filed and dressed propeller blades (and/or) painted propeller blade face. I certify this Propeller has been inspected in accordance with an Annual Inspection and was found to be in an Airworthy Condition.			
	12 x M674 Copper Gasket @ \$0.75T	\$9.00 T		
	1 x AA48109 Oil Filter @ \$50.00T	\$50.00 T		
	1 x BLKSTONE Blackstone Oil Sample @ \$45.00T	\$45.00 T		
2.	Compression check: 1. 66 2. 65 3. 70 4. 75 5. 70 6. 76 orifice 47 Corrective Action	\$0.00	\$0.00	\$0.00
2-1	Compression Test #1)66 #2)65 #3)70 #4)75 #5)70 #6)76 orifice 47			
3.	Left hand muffler heat shield installed backwards Corrective Action	\$0.00	\$87.50	\$0.00
3-1	Remove and reinstall L/hand muffler heat shield -- labor: 0.5 hrs @ \$175.00			
4.	Right hand exhaust hitting airframe Corrective Action	\$0.00	\$87.50	\$0.00
4-1	Adjusted R/hand exhaust to spec -- labor: 0.5 hrs @ \$175.00			
5.	Left hand elevator hinge bushing worn, has play Corrective Action	\$174.24	\$525.00	\$0.00
5-1	R&R L/hand elevator hinge bushing and grounding wire -- labor: 3.0 hrs @ \$175.00			
	2 x 35-600003 Bushing @ \$80.00T	\$160.00 T		
	12 Inch x 858 Tinned Copper Braid @ \$0.85T	\$10.20 T		

Item	Discrepancy	Parts	Labor	
	4 x AP51863 NYL DBL CRIMP @ \$0.40T	\$1.60 T		
	4 x AN526-832R7 Screw @ \$0.11T	\$0.44 T		
	4 x MS21042L08 Locknut @ \$0.50T	\$2.00 T		
6.	Airbox filter is due	\$202.25	\$87.50	\$0.00
	Corrective Action			
6-1	R&R airbox filter			
	-- labor: 0.5 hrs @ \$175.00			
	1 x AA10-5304 INDUCTION AIR FILTER @ \$202.25T	\$202.25 T		
7.	Nose gear horn bushing for shimmy damper needs to be replaced	\$99.00	\$87.50	\$0.00
	Corrective Action			
7-1	R&R NG horn bushing for shimmy damper			
	-- labor: 0.5 hrs @ \$175.00			
	1 x 105739X-ZK0190 Bushing @ \$99.00T	\$99.00 T		
8.	Both main landing gear knee bushings worn, have pay	\$314.40	\$175.00	\$0.00
	Corrective Action			
8-1	R&R Both L/R MLG knee bushings			
	-- labor: 1.0 hrs @ \$175.00			
	2 x 35-810122-1 Bushing @ \$157.20T	\$314.40 T		
9.	#2 cylinder needs to be lapped and replace the roto coil	\$42.58	\$700.00	\$0.00
	Corrective Action			
9-1	R&R #2 exhaust rotor coil, lapped exhaust valve and installed rocker cover gaskets			
	-- labor: 4.0 hrs @ \$175.00			
	1 x SA629117-1 ROTOCOIL @ \$28.28T	\$28.28 T		
	1 x 655528 Gasket @ \$13.80T	\$13.80 T		
	2 x AN931-4-7 Grommet @ \$0.25T	\$0.50 T		
10.	Both left and right brake pads need to be replaced	\$0.00	\$350.00	\$147.20
	Corrective Action			
10-1	R&R Both L/R brake pads, ops check satisfactory			
	-- labor: 2.0 hrs @ \$175.00			
	brake pads			
	Rivets			\$140.00 T
11.	Left side baffle piece by air/oil separator piece is broken off	\$0.00	\$350.00	\$7.20 T
	Corrective Action			\$0.00
11-1	Repaired broken baffle piece			
	-- labor: 2.0 hrs @ \$175.00			
12.	Serviced brakes with 5606	\$15.00	\$175.00	\$0.00
	Corrective Action			
12-1	Serviced brakes system with 5606, ops check satisfactory			
	-- labor: 1.0 hrs @ \$175.00			
	1 x MIL-PRF-5606H Hydraulic Fluid @ \$15.00T	\$15.00 T		
13.	Comply w/ AD 2007-08-08	\$0.00	\$0.00	\$0.00
	Corrective Action			
13-1	Complied w/AD2007-08-08 by visual inspection and ops check.			
Miscellaneous				
	Consumables			\$100.00
	Hazmat Disposal Fee			\$30.00
	Oil filter discount			\$-50.00

LABOR	\$6,125.00
PARTS	\$951.47
MISC	\$227.20
SALES TAX @ 8.750%	\$96.13
TOTAL	\$7,399.80
Payment Received	\$4,323.85
Amount Due	\$3,075.95

are due upon completion of the services performed unless prior arrangements have been made.